



AECL-11911



CA0000119

Steam Generator Life Management

Gestion de la durée de vie des générateurs de vapeur

R. L. Tapping, J. Nickerson, P. Spekkens, C. Maruska

AECL

STEAM GENERATOR LIFE MANAGEMENT

by

R.L. Tapping^{*}, J. Nickerson^{**}, P. Spekkens[†] and C. Maruska[†]

^{*}AECL

Chalk River Laboratories
Chalk River, Ontario, CANADA, K0J 1J0

^{**}AECL

Sheridan Park Research Community
2251 Speakman Drive
Mississauga, Ontario, CANADA, L5K 1B2

[†]Ontario Hydro

Chemistry and Metallurgy Department
700 University Avenue
Toronto, Ontario, CANADA, M5G 1X6

1998 January

AECL-11911

AECL

STEAM GENERATOR LIFE MANAGEMENT

by

R.L. Tapping*, J. Nickerson**, P. Spekkens† and C. Maruska†

ABSTRACT

Steam generators are a critical component of a nuclear power reactor, and can contribute significantly to station unavailability, as has been amply demonstrated in Pressurized Water Reactors (PWRs). CANDU steam generators are not immune to steam generator degradation, and the variety of CANDU® steam generator designs and tube materials has led to some unexpected challenges. However, aggressive remedial actions, and careful proactive maintenance activities, have led to a decrease in steam generator-related station unavailability of Canadian CANDUs.

AECL and the CANDU utilities have defined programs that will enable existing or new steam generators to operate effectively for 40 years. Research and development work covers corrosion and mechanical degradation of tube bundles and internals, chemistry, thermalhydraulics, fouling, inspection and cleaning, as well as provision for specialty tool development for specific problem solving. A major driving force is development of CANDU-specific fitness-for-service guidelines, including appropriate inspection and monitoring technology to measure steam generator condition. Longer-range work focuses on development of intelligent on-line monitoring for the feedwater system and steam generator. New designs have reduced risk of corrosion and fouling, are more easily inspected and cleaned, and are less susceptible to mechanical damage.

The Canadian CANDU utilities have developed programs for remedial actions to combat degradation of performance (Gentilly-2, Point Lepreau, Bruce A/B, Pickering A/B), and have developed strategic plans to ensure that good future operation is ensured.

This report shows how recent advances in cleaning technology are integrated into a life management strategy, discusses downcomer flow measurement as a means of monitoring steam generator condition, and describes recent advances in hideout return as a life management tool. The research and development program, as well as operating experience, has identified where improvements in operating practices and/or designs can be made in order to ensure steam generator design life at an acceptable capacity factor.

*AECL

Chalk River Laboratories
Chalk River, Ontario, CANADA, K0J 1J0

**AECL

Sheridan Park Research Community
2251 Speakman Drive
Mississauga, Ontario, CANADA, L5K 1B2

†Ontario Hydro

Chemistry and Metallurgy Department
700 University Avenue
Toronto, Ontario, CANADA, M5G 1X6

1998 January

AECL-11911

EACL

GESTION DE LA DURÉE DE VIE DES GÉNÉRATEURS DE VAPEUR

par

R.L. Tapping*, J. Nickerson**, P. Spekkens+ et C. Maruska+

RÉSUMÉ

Les générateurs de vapeur constituent un élément crucial d'un réacteur de puissance et peuvent contribuer considérablement à l'indisponibilité d'une centrale, comme on l'a amplement démontré dans les réacteurs à eau sous pression (PWR). Les générateurs de vapeur CANDU ne sont pas à l'abri de détériorations et la diversité des modèles de générateurs de vapeur CANDU^{MD} et des matériaux des tubes ont présenté quelques problèmes inattendus. Toutefois, des mesures correctives énergiques et des travaux d'entretien proactifs vigilants ont permis de réduire l'indisponibilité des centrales canadiennes CANDU en raison des générateurs de vapeur.

EACL et les compagnies d'électricité exploitant des centrales CANDU ont défini des programmes qui permettront aux nouveaux générateurs de vapeur ou à ceux existants de fonctionner efficacement pendant 40 ans. Les travaux de recherche et développement portent sur la corrosion et la détérioration mécanique des faisceaux de tubes et des pièces internes, la chimie, la thermohydraulique, l'encrassement, l'inspection et le nettoyage ainsi que sur la mise au point d'outils spéciaux destinés à résoudre des problèmes ponctuels. Un élément moteur important est la mise au point de directives d'aptitude au service propres à la filière CANDU, et notamment les techniques de surveillance et d'inspection appropriées pour contrôler l'état des générateurs de vapeur. Les travaux à plus long terme sont axés sur la mise au point de la surveillance en ligne intelligente du circuit d'eau d'alimentation et des générateurs de vapeur. Les nouveaux modèles présentent des risques moindres de corrosion et d'encrassement, de plus grandes facilités d'inspection et de nettoyage et sont moins susceptibles aux dommages mécaniques.

Les compagnies d'électricité canadiennes qui exploitent des centrales CANDU ont élaboré des programmes de mesures correctives pour lutter contre les baisses de rendement (Gentilly 2, Pointe Lepreau, Bruce A et B, Pickering A et B) et ont élaboré des programmes stratégiques pour garantir à l'avenir une bonne exploitation.

Le présent rapport montre de quelle façon les progrès tout récents en matière de technique de nettoyage font partie de la stratégie de gestion pendant la durée de vie, examine la mesure de l'écoulement de descente comme moyen de surveillance de l'état des générateurs de vapeur et décrit les derniers progrès de recherche sur le retour d'impuretés comme outil de gestion pendant la durée de vie. Le programme de recherche et développement et l'expérience pratique acquise en exploitation ont permis de déterminer les domaines dans lesquels on peut apporter des améliorations aux méthodes d'exploitation ou de conception afin d'assurer l'exploitation des générateurs de vapeur pendant toute leur vie nominale à un facteur de capacité acceptable.

*EACL

Laboratoires de Chalk River
Chalk River (Ontario) CANADA K0J 1J0

**EACL

Sheridan Park Research Community
2251, rue Speakman
Mississauga (Ontario) CANADA L5K 1B2

+Ontario Hydro

Chimie et Métallurgie
700, avenue University
Toronto (Ontario) CANADA M5G 1X6

1998 Janvier

TABLE OF CONTENTS

	Page
1. INTRODUCTION.....	1
2. CANDU UTILITY EXPERIENCE.....	1
3. CANADIAN CANDU LIFE MANAGEMENT STRATEGIES	2
4. RESEARCH AND DEVELOPMENT ACTIVITIES	4
5. SUMMARY	5
6. ACKNOWLEDGMENTS.....	5
7. REFERENCES.....	5

LIST OF TABLES

Table 1: Summary of design and chemistry specifications for Canadian CANDU stations.....	6
Table 2: Summary of degradation mechanisms found in CANDU steam generators to date.....	7
Table 3: Summary of life management strategy highlights for	8
Table 4: Summary of R&D activities in the COG steam generator program.....	9

LIST OF FIGURES

Figure 1: Ontario Hydro Nuclear station incapability due to steam generator forced and planned outages.	10
Figure 2: Key elements of a steam generator life management program and associated interfaces.	11

1. INTRODUCTION

Until recently CANDU steam generators had an enviable record: virtually no tubes plugged because of corrosion [1]. Since then several Ontario Hydro reactors have experienced steam generator corrosion, fouling degradation, and fretting of the upper bundle. This has led to thermal and hydraulic inefficiencies as well as tube integrity concerns. To date CANDU-6 steam generators have not experienced significant corrosion degradation, although reactor inlet header temperature (RIHT) increases have required remedial action at both Gentilly-2 and Point Lepreau Nuclear Generating Station (NGS).

Hence CANDU steam generators are subject to many of the same problems that have plagued pressurized water reactor (PWRs) for the past 20 years, although to a much lesser degree. This has led to a concerted effort to restore the health of those steam generators that have been degraded, and to proactive measures to ensure that all CANDU steam generators, current and future, meet their design lifetimes. Supporting these efforts is a research and development (R&D) program aimed at providing the knowledge necessary to understand, predict and prevent steam generator degradation.

CANDU steam generators are smaller and different in design than those used in PWRs. Also there are differences in materials, and primary and secondary side chemistries, and CANDU steam generators operate at lower temperatures than those in PWRs. AECL and the CANDU utilities have had to develop their own solutions to steam generator degradation to ensure an effective steam generator service life. Table 1 summarizes the CANDU design and chemistry features.

This report briefly describes the CANDU utility experience with steam generators, the various CANDU steam generator life management strategies that have been put into place, and the supporting R&D program. The report also provides design recommendations for new steam generators.

2. CANDU UTILITY EXPERIENCE

Until the mid 1980's fouling of the secondary side of long-service Ontario Hydro Nuclear (OHN) CANDU steam generators was significant but with little apparent loss of function. By 1990 the support plate flow holes at Bruce-A NGS were ~80% blocked [2,3]. This led to flow instabilities (boiler level oscillations) and a program of secondary side cleaning was initiated. Soon after this, under-deposit corrosion of steam generator tubes in the sludge pile region was found at Pickering-B NGS. At approximately the same time the effects of lead contamination on the Bruce Unit 2 steam generator became evident. Later, sludge pile pitting was discovered at Pickering 1, and fretting became a concern at Bruce-B NGS. These experiences are summarized in Table 2, along with CANDU 6 data. They indicate that prolonged neglect of fouling of CANDU steam generators will lead to thermal performance and corrosion degradation. Repeated detection of fretting wear also indicates that the fabrication of some CANDU steam generators led to some susceptibility to fretting damage in the U-bend.

In addition to tube degradation, a concern with degradation of primary side divider plates, leading to excessive leakage from inlet to outlet, has emerged recently. Divider plates have been replaced at Point Lepreau and Gentilly-2 in 1994/95, and this has had a significant positive impact on steam generator thermal performance.

Despite these problems, the CANDU utilities were able to restore steam generator performance in most units using a program of extensive cleaning, often accompanied with refurbishment. Figure 1 illustrates

the improvement since 1992, in terms of steam generator contributions to incapacity factor, for OHN stations. The intent of the refurbishment was to remove copper alloys from the feedwater train, and to reduce the risk of impurity ingress. The remedial actions are summarized in Table 3. (It is now anticipated that, with the exception of Bruce Unit 2, and with an appropriate life management strategy in place, steam generators should not become the station-life-limiting component in CANDU stations.) At Bruce Unit 2 the extent of lead-induced stress corrosion cracking, and lead contamination, was such that the unit was shut down in 1995 September. Low demand for electricity in Ontario and the projected uncertainty in tube life led to a decision to cease operation. It is anticipated that, should electricity demand, and economics, permit, the Unit 2 steam generators and fuel channels will be replaced and the unit returned to power.

The steam generator remedial actions have largely been based on extensive cleaning campaigns, including the use of specialized water lance equipment and low and high temperature chemical cleaning, and crevice cleaning methods. All of these had to be specifically tailored to the CANDU designs, materials and sludge characteristics. CANDU specific cleaning developments are described in another paper at this conference.

Concerns about U-bend vibration and stress, which have led to fretting, fatigue and stress corrosion cracking of tubes in the U-bend of various steam generators, have led to improvements in U-bend support structures and designs. At Bruce-A, anti-vibration bars (AVBs) were added to stabilize the structure to reduce the risk of mechanical fatigue, stress corrosion cracking and corrosion fatigue. Similarly, at Bruce-B, the installation of AVBs was required to reduce fretting degradation. More recent designs (Darlington Nuclear Generating Station (DNGS), Wolsong-2, -3, -4) use stainless steel flat bar U-bend supports, to provide a greater margin against support-induced stresses on the U-bend tubes than do scallop bar supports. However, the effect on fretting wear, compared to correctly installed scallop bar supports, has not yet been determined.

3. CANADIAN CANDU LIFE MANAGEMENT STRATEGIES

All Canadian CANDU utilities have a steam generator life management strategy. Those utilities that have experienced degradation (Bruce A, Pickering A and B, Point Lepreau, Gentilly-2, Bruce-B) have already carried out remedial actions, as indicated in Table 3, and DNGS has initiated a proactive maintenance strategy. Many of these stations have developed a formal strategic planning document that has been peer reviewed, and the others have operational and maintenance plans that address the same need. Table 3 summarizes the key components of each station's steam generator life management strategy. All stations address the current Electric Power Research Institute (EPRI) recommendations [4], where relevant. The major goals of the plans are to:

- avoid surprises,
- learn from experience, and
- manage the investment in steam generators.

Figure 2 summarizes the key components needed to implement a life management strategy.

The methodology necessary to put a life management strategy in place is first to establish the station objectives with respect to expected service life and required reliability. It is then important to characterize the plausible degradation mechanisms that may affect steam generator life and reliability, and how these may affect station life and reliability. Important here is a sound fitness-for-service (FFS)

plan, and good inspection capability. Steam generator life and reliability is then a function of available remedial actions and a preventive maintenance strategy. This may require equipment modifications, cleaning strategies, effective monitoring programs, and improved chemistry control. Clearly, cost-effectiveness is important, and may vary with time depending on station economics and power demand. Each of the plans summarized in Table 3 has these elements, with the ratio of remedial action to proactive maintenance varying from station to station. Currently Bruce A is still in the remedial action mode, whereas Gentilly-2 and Pickering B are transitioning to the proactive maintenance stage, and Darlington is in the proactive maintenance stage.

Remedial programs have paid particular attention to chemistry control, with upgrading of water treatment plants and condenser upgrades (or upgraded operating procedures such that condenser leaks are no longer tolerated) a major consideration. Chemistry specifications have been tightened, and Ontario Hydro stations place heavy emphasis on maintaining secondary chemistry specifications within guidelines.

For CANDU reactors to benefit fully from their on-power refueling capability, steam generator maintenance must be carried out during the annual, or in some cases biannual, maintenance outages. There may be a need to have an extended maintenance outage for chemical cleaning every 10 years or so, depending on the fouling situation. Many CANDU stations are currently carrying out remedial and rehabilitative actions to redress years of accumulation of deposits. It has been noted that the cost of these activities is similar to the cost of putting this into place, after degradation has occurred, and maintaining effective long-term maintenance strategies designed to avoid future serious degradation [5]. The Darlington steam generator life assurance plan notes that the cost of an extensive proactive maintenance strategy designed to avoid serious degradation will be about 10% of the cost, over the 40 year station life, of rehabilitating the steam generators after they have been subjected to chronic fouling and impurity ingress. Thus it is evident that routine, frequent and, as necessary, enhanced inspection is an essential part of any effective maintenance strategy, along with a good proactive plugging policy. The past measure that no steam generator leaks implied good performance, with little or no knowledge of the actual condition of the steam generator, is now unacceptable and costly.

Coupled with inspection, is the need for a sound and flexible FFS program that addresses plausible station degradation mechanisms. For current CANDU steam generators the variability of designs implies that fouling and corrosion degradation mechanisms will vary from station to station and hence each station will require a different FFS guideline as well as station specific life management plans. For new CANDU steam generators, however, with designs based on the Darlington steam generators, a common set of FFS guidelines may be more plausible, although experience with PWRs suggests this may not be achievable.

From a design perspective there are several factors to consider when striving for a 40-year steam generator life. Perhaps the most important factor, after good chemistry control (and specifications and equipment to assure this), is the need for a leak-tight condenser. For seawater-cooled sites a titanium-tubed condenser with leak-tight tube-to-tubesheet joints (such as Wolsong-1) is recommended to minimize any risk of impurity in-leakage, although few utilities have these. It is often assumed that for fresh-water sites the condenser requirements can be relaxed, but experience at CANDUs and PWRs indicates that this assumption is false [6]. Although the risk of chloride ingress from lakewater in-leakage may be lower, the concentration over time of chloride in steam generator crevices will eventually reach the same levels as seawater in-leakage. Thus leak-tight condensers for fresh water-cooled sites should be as high a priority as for seawater-cooled sites. Other issues related to improved designs for long-term steam generator reliability are outlined in Section 4.

4. RESEARCH AND DEVELOPMENT ACTIVITIES

Within the CANDU Owners Group (COG) there is an R&D program aimed at improving current steam generator reliability and operability, and improving future designs, which would include replacement steam generators if applicable. The entire program covers all aspects of steam generator and balance-of-plant technology, with the primary focus on corrosion, fouling, cleaning, vibration, specialized tooling and non-destructive inspection. Table 4 summarizes the important activities currently underway. Major goals are to put in place the data and tools needed for effective FFS guidelines, to provide effective support for CANDU secondary system chemistry specifications, and to provide input into design requirements, in particular the data needed to ensure that steam generator design life is economically achievable. There is considerable effort aimed at providing steam generator operators with the rationale and tools to improve steam generator performance, especially corrosion, fouling and fretting mechanisms and inspection tooling. In what follows, some recent R&D developments that contribute to design and life management strategies are outlined.

Downcomer flow is a measure of steam generator health. In a recirculating steam generator it indicates steam generator support structure fouling by providing an estimate of the recirculation ratio. Comparison with THIRST code predictions can then be made and an assessment of overall thermalhydraulic efficiencies derived. Downcomer flow measurements can be made in-situ during operation over the entire power range with a non-invasive ultrasonic technique developed by AECL. This technique also detects the presence of void in the downcomer and hence separator efficiency or other steam leak paths can be inferred. Downcomer flow measurements have been made at Bruce A and Darlington, and others are planned. These measurements suggest that cleaning of the Bruce A upper support plates has restored thermalhydraulic behaviour there, and that Darlington is operating as designed.

As noted earlier, chemical cleaning is now part of the CANDU steam generator life management strategy, both for existing and new stations. Research and development in cleaning technology, which is described in more detail in another paper, is oriented towards optimizing available low and high temperature processes for CANDU steam generators, and towards developing dilute or mild cleaning for routine, low-cost and non-corrosive cleaning, probably during shutdowns. This work includes the development of cleaning technology for primary side steam generator fouling, which may be a contributor to increasing RIHT. This fouling also increases radiation fields in the vicinity of steam generators and negatively impacts non-destructive evaluation (NDE) inspection campaigns.

Hideout return studies are an important component of steam generator life management, and provide a direct measure of chemistry control. Such studies at a number of Ontario Hydro stations have shown that good chemistry control has reduced fouling and hideout of impurities [7]. Older units had considerably more impurities "hidden out" than newer ones, which is indicative of the greater degree of fouling in the older units. It also suggests that it is important to maintain a clean steam generator. CANDU stations typically do not operate under molar ratio control guidelines, but analysis of chemistry data for Ontario Hydro stations indicates an operating molar ratio of 0.6 to 0.8. At Bruce A, where boric acid additions are made to inhibit scallop bar corrosion, hideout return studies show that boric acid is indeed penetrating the crevices and deposits, as desired.

As Table 4 shows, there is considerably more R&D that is having an impact on steam generators, much of it aimed at improving inspection technology and quantifying design requirements and operating specifications. Changes in these requirements and specifications can be made only if there is a good understanding of the science and engineering behind them, so that their impacts can be properly assessed.

5. SUMMARY

While CANDU steam generators had an enviable record until 1988, recent experience has shown that they are not immune to some of the problems that have plagued PWR plants. To address these, the CANDU utilities have put in place aggressive steam generator life management programs. AECL and COG have undertaken proactive research and development work aimed at both supporting these life management programs and providing knowledge to lead designs for future units. It is recommended that a rigorous and detailed life management program be put in place at all CANDU stations. A detailed assessment of all potential degradation mechanisms is a key ingredient of the program.

6. ACKNOWLEDGMENTS

The authors acknowledge COG for its support of the steam generator program, and the stations for their assistance in dealing with steam generator issues over the years. Contributions of P.V. Balakrishnan (AECL) are gratefully acknowledged.

7. REFERENCES

1. R. Dyck, A. Marchand, P. Spekkens and K. Verma, "Operational Experience with Steam Generators in Canadian Nuclear Power Stations", Proc. Steam Generator and Heat Exchanger Conference, p. 1-10 (Toronto, 1990, CNS).
2. J. Malaugh and S. Ryder, "Bruce NGS-A Support Plate Inspection and Waterlancing", Proc. Steam Generator and Heat Exchanger Conference, p. 3-51 (Toronto, 1990, CNS).
3. S. Roy, "Steam Generator Performance and Life Management Decisions in Bruce A Nuclear Generator Station", Proc. Steam Generator and Heat Exchanger Conference, p. 1-47 (Toronto, 1994, CNS).
4. R.L. Tapping, "Steam Generator Life Management Strategy: An Overview", unpublished report, 1995 August.
5. K. Talbot, luncheon address to the CANDU Maintenance Conference, Toronto, 1995 November.
6. L.M. Stipan and R.L. Tapping, "Steam Generator Tube Performance: Experience with Water-Cooled Nuclear Power Reactors during 1988-1991", unpublished report, 1995 October.
7. P.V. Balakrishnan, S.M. Pagan, A.M. McKay and F. Gonzalez, "Hideout and Return: Laboratory Studies and Plant Measurements", paper presented at the Specialists' Meeting on Improving the Understanding and Control of Corrosion on Secondary Side of Steam Generators, Airlie, VA, 1995 October 9-13; also CANDU Owners Group Report COG-I-95-555.

Table 1: Summary of design and chemistry specifications for Canadian CANDU stations.

Plant History	PICKERING A (4x542 MWe)	PICKERING B (4x540 MWe)	BRUCE A (4x904 MWe)	BRUCE B (4x915 MWe)	DARLINGTON (4x935 MWe)	CANDU 600	
						POINT LEPREAU (680 MWe)	GENTILLY-2 (685 MWe)
Commercial Operation	U1 July '71 U2 Dec '71 U3 June '72 U4 June '73	U5 May '83 U6 Feb '84 U7 Jan '85 U8 Feb '86	U1 Sep '77 U2 Sep '77 U3 Feb '78 U4 Jan '79	U5 Mar '85 U6 Sep '84 U7 Apr '86 U8 May '87	U1 Nov '92 U2 Oct '90 U3 Feb '93 U4 Jan '93	Feb '83	Oct '83
Number of tubes/SG	2600	2573	4200	4200	4663	3550	3550
Thermal Output/SG	138 MWt	138 MWt	280 MWt	280 MWt	664 MWt	516 MWt	516 MWt
Tube Material	Monel 400	Monel 400	Inconel 600	Inconel 600	Incoloy 800	Incoloy 800	Incoloy 800
Tube Size (OD)	12.7 mm	12.7 mm	12.7 mm	12.7 mm	15.9 mm	15.9 mm	15.9 mm
T _{hot} /T _{cold} (°C)	293°C/249°C	290°C/249°C	304°C/265°C	304°C/265°C	309°C/265°C	310°C/266°C	310°C/266°C
Steam Temperature	252°C	252°C	256°C	256°C	265°C	260°C	258°C
Tube Supports	C-steel Lattice Bars	C-steel Trifoil Broached TSP	C-steel Trifoil Broached TSP	C-steel Trifoil Broached TSP	410S SS Lattice bars	410S SS Trifoil Broached TSP	410S SS Trifoil Broached TSP
U-bend Supports	C-steel (Cu bearing) Lattice bars	Staggered C-steel scallop bars	Stacked C-steel scallop bars	Staggered C-steel scallop bars	Flat 410S AVBs	410 S SS staggered scallop bars	410S SS staggered scallop bars
Tube Expansion	Hard roll, near secondary face				Hydraulic, near secondary face	Hydraulic	Hydraulic
Secondary System	Ferrous/Copper	Ferrous/Copper (Cu being removed)	Ferrous/Copper (Cu being removed)	All ferrous	All ferrous	All ferrous; full flow deep bed polishers	Ferrous/Copper
Feedtrain Heaters	LP: Admiralty Brass HP: 90/10 Cu/Ni Reheater: carbon steel	LP: Admiralty Brass HP: 90/10 Cu/Ni Reheater: carbon steel	LP: Admiralty Brass HP: 90/10 Cu/Ni Reheater: carbon steel	LP: stainless steel HP: stainless steel Reheater: carbon steel	LP: stainless steel HP: stainless steel Reheater: carbon steel	LP: stainless steel HP: stainless steel Reheater: carbon steel	LP: stainless steel HP: carbon steel Reheater: carbon steel
Preheater	Integral	Integral	Separate	Separate	Integral	Integral	Integral
Condenser Tubes	Admiralty Brass (304SS outer)	Unit 5 Titanium; Unit 6 to be changed to titanium Units 7/8 Admiralty Brass (304SS outer tube)	Admiralty Brass (304SS outer)	304L SS	Titanium	Titanium	Admiralty Brass (316 outer)
Secondary Chemistry	AVT/morph/ N ₂ H ₄	AVT/morph/ N ₂ H ₄	AVT/morph/ N ₂ H ₄ Boric Acid	AVT/NH ₃ / N ₂ H ₄	AVT/NH ₃ /N ₂ H ₄	Phosphate & Morph/N ₂ H ₄	AVT/Morpholine
Condenser Water	Lake Ontario	Lake Ontario	Lake Huron	Lake Huron	Lake Ontario	Sea water (Bay of Fundy)	St. Lawrence River
Condensate Polishing	No	No	No	No	No	Full-time Full-flow	No

Table 2: Summary of degradation mechanisms found in CANDU steam generators to date.

UNIT	PROBLEM	CAUSE	COMMENTS
Pickering-A	Pitting/wastage in sludge piles	Deep sludge piles. Poor chemistry control (for all Pickering units) for some time.	Crevice cleaning carried out in Units 1 and 2. SG visually clean; residual tube sheet sludge pile. Pitting mainly in Unit 1.
	RIHT increase	Primary side fouling? Divider plate leakage?	Primary side cleaning of straight legs in Unit 1 produced no improvement in RIHT.
Pickering-B	Pitting/wastage in sludge piles and first support-plate broaches RIHT increases	Sludge piles; heavy deposits; condenser in-leakage. Secondary/primary side fouling. Poor chemistry control (for all Pickering units) for some time.	Feedwater chemistry upgrading taking place. Cu in sludge. Chemical cleaning of Units 5 and 6 resulted in no improvement in RIHT but left SGs visually clean.
Bruce-A	IGSCC/IGA in U-bend at scallop bars	Denting of tubes at scallop bar intersections and "jacking" of scallop bars. Lead (Pb) contamination in Unit 2 accelerated cracking. Some fatigue/corrosion fatigue involvement.	Feedwater chemistry upgrading taking place. Cu and Pb in sludge. Secondary side chemical cleaning carried out in Units 1, 3 and 4.
	Shallow pitting in sludge pile	Possibly acidic sulphate conditions.	Sulphuric acid ingress from water treatment plant in 1985.
	Boiler level oscillations	Fouling of upper support plate.	Lancing effective in stopping oscillations.
	Fatigue Scallop bar corrosion	Excessive vibration. Unknown. Possibly related to crevice corrosion under deposits/acidic conditions.	May be some flow assisted corrosion also.
Bruce-B	Fretting at U-bend and top support plate	Excessive clearances of U-bend supports.	
	Shallow pitting in sludge pile	Possible acid and caustic excursion (WTP in 1989).	
	RIHT increasing	Divider plate leakage? Primary side fouling?	Secondary side visually clean. Unit 6 has most significant increase.
Point Lepreau	U-bend fretting/minor pitting	U-bend support design? Underdeposit corrosion.	Secondary side clean carried out.
	RIHT increasing	Divider plate leakage. Primary or secondary side fouling?	Recovered ~2°C in RIHT. Floating one-piece divider plate installed. Primary side clean carried out.
Gentilly-2	RIHT increasing	Divider plate leakage. Primary or secondary side fouling?	Recovered ~2.5°C in RIHT. Floating one-piece divider plate installed. Did not carry out large-scale primary side cleaning


Table 3: Summary of life management strategy highlights for Canadian CANDU steam generators.

UNIT	LIFE MANAGEMENT PLAN HIGHLIGHTS
Bruce-A	<p>Manage existing degradation mechanisms and maximize SG life:</p> <ul style="list-style-type: none"> • clearing to remove deposits on tubes, supports, tubesheets • replace all copper components on secondary side • improve water treatment plant • boric acid • wet lay-up recirculation system • high hydrazine chemistry • refurbishment of steam generator intervals to remove stresses and reduce flow-induced vibration • extensive tube inspection/plugging • hot soaks implemented • new water treatment plant • reduction of condenser and air in-leakage • optimization of pH/amine control
Bruce-B	<p>Manage existing fretting. Proactive means to prevent corrosion and RIHT increase:</p> <ul style="list-style-type: none"> • enhance in-service inspection to determine fretting extent/severity • evaluation of effectiveness of prototype U-bend modifications • preparation of enhanced ISI for non-fretting degradation • monitor deposit buildup • evaluate cleaning
Pickering A	<p>Manage existing degradation:</p> <ul style="list-style-type: none"> • secondary side cleaning • condenser retube of air removal zone • high hydrazine • improve condenser in-leakage detection and repair • routine blowdown • improve water treatment plant • hot soaks • primary side cleaning
Pickering B	<p>Manage pitting degradation:</p> <ul style="list-style-type: none"> • extensive inspection/plugging • replace copper in feedtrain (including condenser) • high hydrazine • improve water treatment plant • tube sleeving development • water lancing and chemical clean of all steam generators • improved condenser and air in-leakage detection and repair
Darlington NGS	<p>Proactive program of maintenance, inspection and good chemistry control:</p> <ul style="list-style-type: none"> • enhanced in-service inspection to detect degradation as soon as possible • water lancing of all steam generators every four years • process qualification and conceptual design work for chemical cleaning
Point Lepreau NGS	<p>Manage existing degradation:</p> <ul style="list-style-type: none"> • secondary cleaning to control corrosion • improve chemistry control (move to AVT?) • remove primary side deposits • replace divider plate
Gentilly-2	<p>Maintain clean steam generator and good chemistry control:</p> <ul style="list-style-type: none"> • replace divider plate

Table 4: Summary of R&D activities in the COG steam generator program.

TECHNOLOGY	APPLICATIONS
CHEMISTRY	Crevice chemistry/hideout/hideout return for CANDU SGs Sludge Pile Chemistry Molar ratio control studies for CANDU Boric acid addition to the secondary side Zinc additions to the primary circuit (primary side fouling/outlet feeder flow-assisted corrosion (FAC)) Amine chemistry Electrochemical potential (ECP) correlations
CORROSION/FATIGUE	IGA/IGSCC of Alloys 400, 600, 800, 690 under CANDU conditions Pitting of CANDU SG tubing Corrosion fatigue/fatigue of CANDU SG tubing, especially in U-bend Corrosion of carbon steel supports Corrosion inhibitors Corrosion monitoring
FOULING	SG fouling mechanisms and predictions (SLUDGE code development) Corrosion-product transport (CPT) characterization, prediction and assessment (on-line CPT monitor development, control system development, oxide solubility measurements) Applications of CHECWORKS to assess FAC contribution to primary and secondary SG tube fouling Additives for reduction of deposition In-situ sludge characterization (laser Raman, X-ray fluorescence) Sludge chemistry RIHT prediction code Thermal properties of tubes and deposits
CLEANING	Improvements to chemical cleaning processes for CANDU sludge chemistry On-line and dilute cleaning developments Ultrasonically-assisted chemical cleaning Primary side cleaning technology Corrosion monitoring (for cleaning) technology
VIBRATION AND FRETTING	Vibration and fretting assessments of all CANDU SG designs (PIPO, VIBIC and H3DMAP codes) Fretting fatigue evaluation Underlying vibration and fretting mechanisms
THERMALHYDRAULICS	Thermalhydraulic evaluations of CANDU SG designs (THIRST code) Evaluation of effects of supports on thermalhydraulics Downcomer flow monitoring technology
INSPECTION AND TOOLING	Eddy current probes for CANDU SG tubing and ultrasonic probes for CANDU SG degradation Eddy current data handling development Specialized tooling for SGs (plug leak detector, tube slitting tool, tube sampling tool, sludge sampling tool, i.d. replication tool)
TECHNOLOGY TRANSFER	Fitness-for-Service guidelines development and database generation. World-wide steam generator survey Specialized symposia on topics of interest to SG owners

Ontario Hydro Nuclear Station Incapability due to Steam Generators Forced and Planned Outages

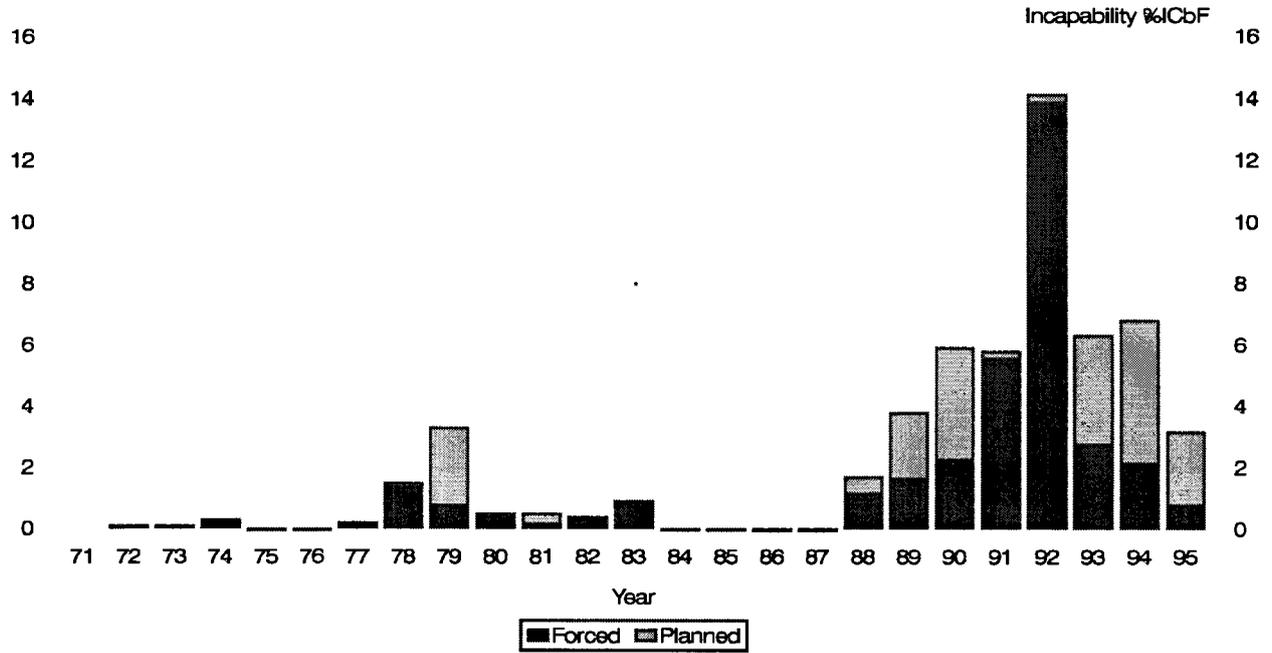

176 Steam Generators, 591,712 tubes in total in service

Figure 1: Ontario Hydro Nuclear station incapability due to steam generator forced and planned outages.

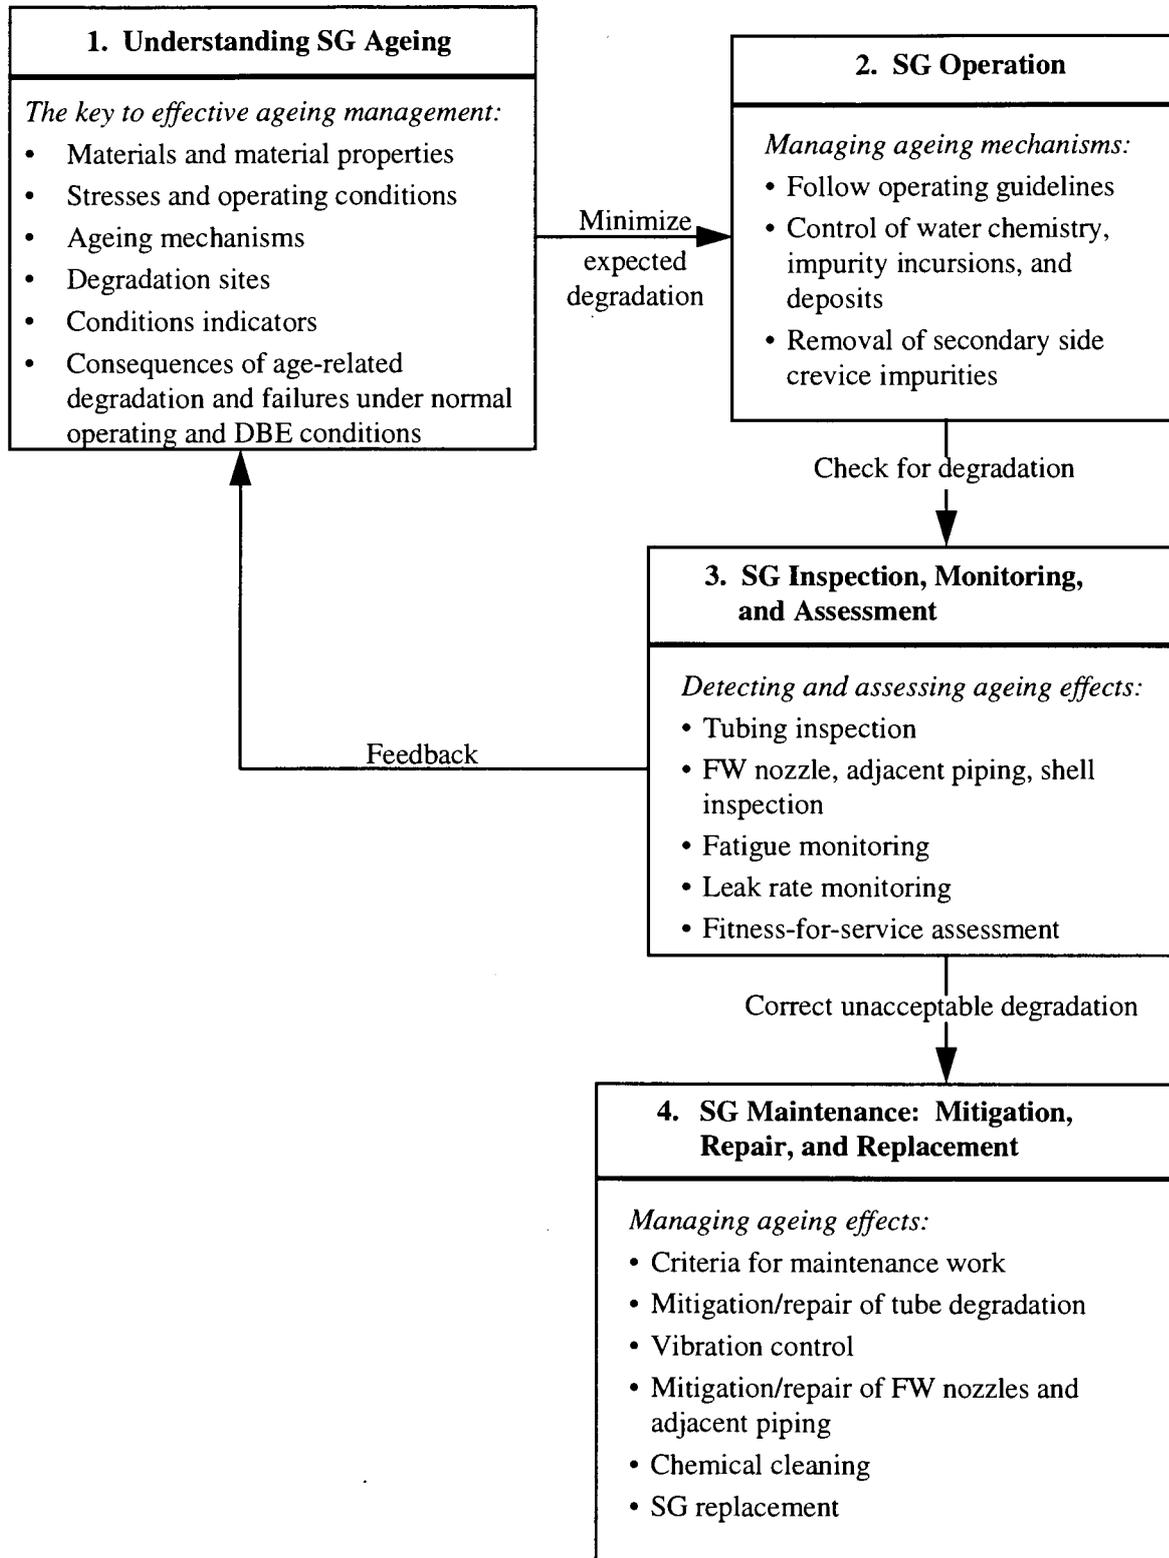


Figure 2: Key elements of a steam generator life management program and associated interfaces. (From IAEA document "Assessment and Management of Ageing of Major Nuclear Power Plant Components Important to Safety: Steam Generator", 1996.)

DISTRIBUTION LIST

P.J. Allen	06476	SP2F3
C.J. Allan	00390	WL, Stn. 74
S. Azeez	04410	SP2F3
K.A. Burrill	01221	CRL, Stn. 61
F.W. Doyle	71176	SP2F4
P.J. Fehrenbach	27640	CRL, Stn. 65
T.S. Gendron	00651	CRL, Stn. 61
J. Gulens	00215	CRL, Stn. 83
R.S. Hart	04483	SP1F1
K. Hau	04384	SP2F4
E.M. Hinchley	04917	SP1F3
R.A. Holt	20304	CRL, Stn. 82
J. Hopkins	08298	SP2F3
H. Keil	08021	SP2F2
C.A. Kittmer	02028	CRL, Stn. 42
R.M. Lepp	01890	CRL, Stn. 48A
E. Moskal	06323	SP2F3
V. Murphy	05076	SP2F3
F. Nuzzo	09885	SP2F1
J.M. Pietralik	02596	CRL, Stn. 456
E.G. Price	03877	SP1F1
D.A. Scott	00775	SP3F1
B. Shalaby	03785	SP2F2
M. Soulard	03894	SP2F4
R.A. Speranzini	03071	CRL, Stn. 61
N. Subash	09919	SP2F3
C.E. Taylor	20016	CRL, Stn. 42
C.W. Turner	02962	CRL, Stn. 80
S.A. Usmani	03902	SP2F4
A. Vikis	09153	CRL, Stn. 86
D. Wren	05331	CRL (J.L. Gray), Stn. E4

ISSN 0067-0367

To identify individual documents in the series, we have assigned an AECL- number to each.

Please refer to the AECL- number when requesting additional copies of this document from:

Scientific Document Distribution Office (SDDO)
AECL
Chalk River, Ontario
Canada K0J 1J0

Fax: (613) 584-1745

Tel.: (613) 584-3311
ext. 4623

Price: A

Pour identifier les rapports individuels faisant partie de cette series, nous avons affecté un numéro AECL-à chacun d'eux.

Veillez indiquer le numéro AECL- lorsque vous demandez d'autres exemplaires de ce rapport au:

Service de Distribution des Documents Officiels
EACL
Chalk River (Ontario)
Canada K0J 1J0

Fax: (613) 584-1745

Tel.: (613) 584-3311
poste 4623

Prix: A

